
NORTH DAKOTA STATE UNIVERSITY

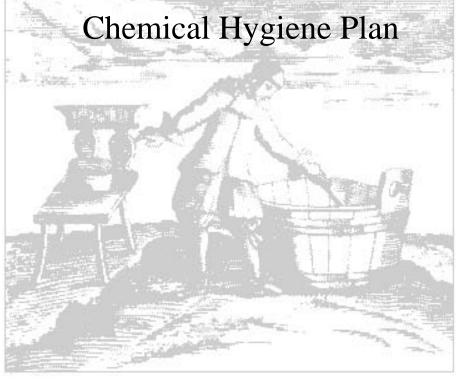

2015 Lab and Chemical Safety Committee:

Uwe Burghaus, Associate Professor, Chemistry and Biochemistry; Joel Caton, Professor, Animal Science; Stuart Croll, Professor, Coatings & Polymeric Materials; Wenhao Dai, Associate Professor, Plant Sciences; Kenneth Lepper, Professor, Geosciences; Wei Lin, Associate Professor, Civil Engineering; Steven Meinhardt, Associate Professor, Plant Pathology; Steven Qian, Associate Professor, Pharmaceutical Sciences; Katie Reindl, Assistant Professor, Biological Sciences; Kent Rodgers (Chair), Professor, Chemistry and Biochemistry; Jane Schuh, Associate Professor, Veterinary and Microbiological Sciences; Michael J. Strand, Department Head, Visual Arts; Scott Wood, Dean, College of Science and Mathematics; Bret Mayo, Associate Director, Environmental Health and Safety, University Police & Safety Office

Ver. 11172015

North Dakota State University does not discriminate on the basis of age, color, disability, gender expression/identity, genetic information, marital status, national origin, public assistance status, sex, sexual orientation, status as a U.S. veteran., race or religion. Direct inquiries to the Vice President for Equity, Diversity and Global Outreach, 205 Old Main, (701) 231-7708.

701.231.7211 Fax 701.231.8722

Office of the President NDSU Dept. 1000 P.O. Box 6050 Fargo, ND 58108-6050

September 20, 2010

Dear Faculty, Staff, and Students of North Dakota State University:

In the use of chemicals and other hazardous substances, all investigators at North Dakota State University must follow procedures to assure the chemical safety of employees and students. These procedures apply to all education and research activities conducted by faculty, students, staff, or other representatives of the University.

In order to comply with state and federal regulations relevant to the safe use of hazardous substances, North Dakota State University has established an institutional committee competent to oversee the implementation and enforcement of the NDSU Chemical Hygiene Plan. This committee has been designated as the University Laboratory and Chemical Safety Committee.

The primary functions of the University Laboratory and Chemical Safety Committee are:

- 1. To maintain and revise the NDSU Chemical Hygiene Plan as appropriate to ensure compliance with regulatory changes.
- 2. To advise the University administration on changes to ensure regulatory conformity.
- 3. To assist and support the Environmental Health and Safety Coordinator in maintaining adherence to the management plan and other regulatory requirements.

This committee will include a representative of the University's Administration.

All educational and research activities involving the use of hazardous substances shall be conducted under the conditions of the NDSU Chemical Hygiene Plan. All members of the University community are expected to comply with both the spirit and the letter of this plan.

Dean L. Breso President

Sincere

I.	IN	NTRODUCTION	3
Α		Background	3
В		LEVELS OF RESPONSIBILITY	
С		DEFINITIONS	
	1.		
	2.		
	3.		
	4.		
	5.	5. Field Use	5
II.	c	SAFETY PROGRAM	-
II.	3		
Α		Inventory Control	_
В	-	TRAINING	
С		CONTROL STRATEGY	
	1.		
	2.		
_	3.		
D		FACILITY REQUIREMENTS (MINIMUM)	
E	-	OPERATIONAL PRACTICES	
F.	_	PERSONNEL PRACTICES	
	1.		
	2.	o	
	3.	, ,	
	4.	,	
	5.		
	6.	3	
	7. 0	<u> </u>	
	8. 9.	3	
G		INSPECTIONS	
G			
III.	W	VORKING WITH NANOMATERIALS	13
Α	_	INTRODUCTION	13
В		Purpose	
C		CONTROL PREFERENCES	
D		ENGINEERING CONTROLS	
	1.	. Ventilation	
Ε		ADMINISTRATIVE CONTROLS	14
	1.	. Housekeeping	14
	2.		
	3.	B. Signage	15
	4.		
F.		PERSONAL PROTECTIVE EQUIPMENT	15
	1.		
	2.	3	
	3.		
	4.	· · · · · · · · · · · · · · · · · · ·	
	5.	•	
G	-	PERSONNEL IDENTIFICATION	
Н		TRAINING	
I.		MEDICAL SURVEILLANCE	
J.		WASTE	
K		NANOMATERIAL SPILLS	17
IV.	E	MERGENCY PROCEDURES	18

Α	A. NEAR MISS OR HAZARDOUS SITUATION	18
٧.	CHEMICAL WASTE MANAGEMENT	18
Α	. General Policies	19
APP	PENDIX 1-GUIDANCE ON SPILLS AND OTHER ACCIDENTS	22
I.	MINOR SPILLS INVOLVING MINIMAL TOXIC HAZARDS TO PERSONNEL	22
	1. Liquid spills:	
	2. Dry spills:	
II.	MAJOR SPILLS INVOLVING TOXIC HAZARDS TO PERSONNEL	22
III.	ACCIDENTS INVOLVING TOXIC DUSTS, MIST, FUMES, ORGANIC VAPORS AND GASE	
IV.	FIRES OR OTHER MAJOR EMERGENCIES	
٧.	FIRST AID	
APP	PENDIX 2-CHEMICAL WASTE REMOVAL	
I.	REQUESTING CHEMICAL WASTE REMOVAL	25
APP	PENDIX 3-DEFINITIONS	26
I.	DEFINITION OF AHAZARDOUS WASTE@	26
Α	CHARACTERISTICS OF HAZARDOUS WASTE (40 CFR, PART 261, SUBPART C)	26
	1. Ignitability/Flammability (Environmental Protection Agency Identification NoD001)	26
	2. Corrosivity (Environmental Protection Agency Identification NoD002)	
	3. Reactivity (Environmental Protection Agency Identification NoD003)	
_	4. Carcinogenic Chemicals	
В		
	1. Pesticides	
	2. Carcinogens	
	4. Highly toxic	
	5. Peroxidizable Chemicals	
	6. Polyhalogenated Biphenyls	
	7. Asbestos	
	8. Miscellaneous material	
APP	PENDIX 4-HAZARDOUS WASTE FORM	30
APP	PENDIX 5-TOXINS, SELECT AGENTS AND EXPORT ITEMS	31
I.	HIGHLY TOXIC SUBSTANCES	
II.	SELECT AGENTS AND TOXINS	31
III.	EXPORT CONTROLLED ITEMS	31
IV.	REFERENCES:	31

I. Introduction

A. Background

North Dakota State University is involved with many materials that, during some phase of usage, may present a marginal to severe hazard to staff and students unless used properly. This is the basis of the formation of the NDSU Laboratory and Chemical Safety Committee and ultimately the establishment of this Chemical Hygiene Plan.

North Dakota State University has an ongoing concern for the safety and health of its employees, the student body, and the general public who may be exposed to University activities that involve the use of hazardous materials/substances or the generation of hazardous waste. The University recognizes a responsibility for ensuring that all campus activities involving hazardous materials/substances and hazardous waste are conducted with minimal hazard to employees, students, and the general public and in a manner so as to conform with applicable local, state, and federal regulations.

Biosafety

A separate biosafety policy and manual are maintained by the NDSU Institutional Biosafety Committee.

Radiation Hazards

A separate radiation hazard policy and manual are maintained by the NDSU Radiation Safety Committee.

Standard Operating Procedures

SOPs can be found in each laboratory and are the responsibility of each laboratory Principal Investigator or Instructional Supervisor, see II.B: Training.

B. Levels of Responsibility

In order for the University to fulfill its recognized obligations and concerns, the policy of the University is to formulate and follow a chemical hygiene plan for the safe use and handling of hazardous materials/substances and proper disposal of hazardous waste. The plan provides for the training of employees and students involved with hazardous materials/substances. Levels of responsibility in this plan are as follows:

- 1. The University's Administration shall designate a Dean, such as the Dean of the Graduate School and Interdisciplinary Studies, to the University Laboratory and Chemical Safety Committee.
- The University Laboratory and Chemical Safety Committee will:
 Maintain and revise the Chemical Hygiene Plan as appropriate to ensure compliance with regulatory changes.

Advise the University Administration on changes to ensure regulatory conformity.

Assist and support the Hazardous Chemical Officer in maintaining adherence to the chemical hygiene plan and other regulatory requirements.

- 3. The Dean of each College and the Chair or Head of each department shall be responsible for seeing that the Chemical Hygiene Plan is implemented and followed. The Chair or Head may designate a department representative for this purpose. The representative shall oversee the training of employees and students, and manage safety concerns in the department. The Chair or Head shall also verify implementation of corrective action for noted safety deficiencies.
- The Hazardous Chemical Officer shall:

- a. Have authority to suspend any activity posing an imminent danger to students, employees, or the general public.
- b. Apprise the Laboratory and Chemical Safety Committee of regulatory revisions and recommend safety-related actions as the situation dictates.
- c. Cooperate with department safety representatives in adhering to the safety provisions in the chemical hygiene plan.
- d. Teach the NDSU Laboratory and Chemical Safety Short Course.
- e. Upon request, assist the department representatives in additional safety training for employees and students.
- f. Maintain records of trained personnel.
- g. Coordinate an annual safety inspection of each laboratory to determine adherence to this policy and other required regulations.
- 5. The Principal Investigator or Instructional Supervisor shall:
 - a. Provide safety training in specific practices.
 - b. Require workers and students under their supervision to follow safety. procedures and use protective equipment as appropriate
 - c. Be responsible for hazardous materials/substances in their possession. Additional requirements including more in depth review of research protocols exist for the following materials and items:
 - 1.) highly toxic substances;
 - 2.) select agents and toxins;
 - 3.) export controlled items.
 - Refer to Appendix 5 for more information on these substances and items.
 - d. Ensure that the Hazardous Chemical Officer is notified of any accidental spill or potential exposure involving toxic substances.
 - e. Correct safety and compliance deficiencies.
- 6. Students and employees working in laboratories, studios or the field; or other campus locations where chemicals are used, bear personal responsibility for their safe working practices, including:
 - a. knowing, completing, and following all training relevant to their potentially hazardous tasks
 - b. following all safety procedures as explained during training
 - c. using protective equipment as appropriate
 - d. using hazardous materials/substances only in approved facilities
 - e. notifying the laboratory supervisor immediately if they encounter a task or situation for which they are not adequately prepared/trained.

C. Definitions

1. Hazardous Material

Materials that, during some or all stages of use, are a health and/or safety hazard. Hazardous and toxic substances/materials can be defined as those chemicals present in the workplace that are capable of causing harm. In this definition, the term chemical includes dusts, mixtures, and common materials, such as paints, fuels, and solvents. OSHA - Hazardous Substance: 1) Any material that poses a threat to human health and/or the environment. Typical hazardous substances are toxic, corrosive, ignitable, explosive, or chemically reactive. 2) Any substance

designated by the EPA to be reported if a designated quantity of the substance is spilled in the waters of the United States or is otherwise released into the environment.

2. Hazardous Materials/Substances Use

The controlled instructional laboratory, research laboratory, field, clinical, or maintenance use of materials for the purpose of demonstrating or developing a means of intended achievement. This includes all phases of materials handling, storage, application, and transportation. Examples of materials are acids, carcinogens, irritants, corrosives, flammables, germicides, pesticides, poisons, and oxidizers.

3. Hazardous Wastes

These are by-products, residues, spent materials, or other accumulations of altered, outdated, or unwanted materials that are hazardous. These materials exhibit properties of ignitability, corrosivity, reactivity, or toxicity and are more completely defined in Appendix 3. Hazardous Waste: By-products of society that can pose a substantial or potential hazard to human health or the environment when improperly managed, possesses at least one of four characteristics (ignitability, corrosivity, reactivity, or toxicity), or appears on special EPA lists.

4. Laboratory Use

The use of hazardous materials/substances for what is generally recognized as an approved academic or research laboratory activity.

5. Field Use

The use of hazardous materials/substances in a non-laboratory setting.

- **6. Instructional Supervisor** The individual who is directly responsible for developing and managing an academic laboratory or field activity.
- **7. Principal Investigator (P.I.)** The individual who is directly responsible for developing and managing a laboratory or field research activity.

II. Safety Program

A. Inventory Control

Each Principal Investigator (P.I.) or other authorized user is accountable for each hazardous substance or potentially hazardous operation in his/her possession from the time of receipt to its final disposal or depletion. The Principal Investigator must check Material Safety Data Sheets and labels to determine the hazards and toxicity of materials procured. A current inventory of hazardous materials/substances, by name, amount, and hazard classification shall be maintained for all substances in storage and/or use in each laboratory. This will serve to comply also with the North Dakota Employee Information (Right-To-Know) Act.

Each laboratory shall hold a current file of Material Safety Data Sheets (MSDS), for all the materials used in that laboratory. This file should be visible from the entrance to the laboratory so that Emergency Services personnel can find relevant information quickly, if they are called to an accident. The Safety Office supplies specially marked, green three-ring binders for this purpose.

No hazardous material can be used before receipt and consideration of an MSDS for that material.

Note that each building has a storage limit for each class of hazardous material. It is important to ensure that hazardous storage does not exceed safety codes.

All containers that hold potentially hazardous materials/substances shall be labeled according to the NFPA code. Blank stickers are available from the Safety Office. Information on how to fill in the rankings for a particular material is often found in the MSDS.

B. Training

The Department Chair or Head (or the Chair's/Head's designee) must ensure that all employees in that department subject to potential exposure to hazardous materials/substances are provided adequate health and safety instructions and training. As a minimum, adequate training shall include completion of the NDSU Laboratory and Chemical Safety Short Course, and additional safety training in specific work practices by the Principal Investigator or department designee.

The Hazardous Chemical Officer will:

Teach the NDSU Laboratory and Chemical Safety Short Course.

Maintain employee training records.

Upon request, assist the Department Chair's designee or P.I. in additional employee training.

Instruct custodial and maintenance personnel in the Hazard Communication Standard.

Maintain Material Safety Data Sheets (MSDS) for all hazardous materials/substances and have them available for use by employees and students.

- 2. The Department Chair, Chair's designee, Instructional Supervisor, or Principal Investigator will train laboratory workers in the following topics:
 - a. Possible sources of toxic substances.
 - b. Carcinogenic and other adverse health effects associated with such exposure.
 - c. Work practices and use of proper equipment and facilities to limit exposures.
 - d. Proper work practices to protect fellow employees.
 - e. Emergency Procedures.
 - f. Document safety training.

Standard Operating Procedures (SOPs) for recurring hazardous tasks unique to a particular laboratory are the responsibility of the Principal Investigator or Instructional Supervisor. The creation of SOPs may be delegated to members of the laboratory group. Delegated SOPs must be approved by the Principal Investigator or Instructional Supervisor prior to use. Students and staff shall be apprised of the SOPs and instructed in their contents. Each laboratory shall maintain a current file containing all the relevant SOPs. Operating manuals for instruments and equipment will fulfill SOP requirements for using them provided that the responsible party has ascertained that they contain adequate safety guidance.

C. Control Strategy

This section describes situations in the use of hazardous substances where different levels of safeguards are specified to protect the employee or student. For information about required safety measures for a particular laboratory, type of chemical, or quantity of chemical, the MSDS or SOP file for that laboratory should be consulted. The Hazardous Chemical Safety Officer should be consulted if no other guidelines are available. The hazard in working with toxic substances is a function of the exposure potential and the toxicity of these substances. The risk of exposure to a toxic substance is related, among other things, to the quantity and physical properties of material used and the nature, frequency, and complexity of the experimental procedure. There may be a greater risk of exposure when working with 100 mg of the same material than with 1 mg of material.

Similarly, the potential for exposure may be greater during blending, preparation of dry feed mixture, and in the manipulation of powders than during the preparation of aliquots of stock solution.

Chemicals of unknown identity or known chemicals whose toxicity, carcinogenicity, or stability is unknown cannot be used until their MSDS has been received and understood.

Chemicals that have been synthesized in the laboratory should be labeled by contents, date of synthesis, and owner, and have an NFPA label according either by comparison with known, analogous materials, or according to the most hazardous material included in the synthetic procedure.

If synthesized chemicals are transferred within NDSU research groups, the hazards of the material must be communicated with the group receiving the material. If synthesized chemicals are transferred to non NDSU research groups, MSDS's must be created and must accompany these chemicals. The party responsible for the creation of the MSDS's is the PI or their designee. The MSDS format should follow the ANSI recommendations using the 16 standardized sections. See the Safety Office website for information on how to create these forms.

Department of Transportation (DOT) hazardous material regulations would apply if the synthesized chemical were to be transported from NDSU property. To ensure DOT shipping regulations are followed, coordinate with one of the members of your department who has received DOT shipping training. The Safety Office may also be contacted for guidance.

Departments who transport hazardous materials on campus from building to building must comply with the DOT requirements including training. Specifically when transporting hazardous materials on campus, faculty, staff, and students must use:

- Only interior campus roads. Not 18th Street N, 12th Avenue N, etc.
- Only State Fleet vehicles or by foot.

Do not use private vehicles or public transportation to transport hazardous materials.

If transport of your material requires the use of public roads, additional DOT regulations may apply. Contact the Safety Office for assistance.

Based on the factors just discussed, control practices needed in a laboratory will fall into one of three categories:

1. Low Risk Situation

Safety during operations with non-regulated compounds can normally be achieved by strict adherence to good laboratory practice.

The laboratory worker must not eat, drink, smoke, chew gum or tobacco, apply cosmetics, or store food in areas where the toxic substances are used or stored. Gloves should be worn or hands must be washed following the completion of a procedure in which toxic substances are used. The laboratory workers must develop the habit of keeping hands away from mouth, nose, eyes, and face. A laboratory coat and gloves must be worn when handling hazardous substances. Mechanical pipetting aids must be used for all pipetting procedures.

Stock quantities of compounds must be maintained in a secured and appropriate storage area when not in use.

2. Intermediate Risk Situation

More stringent safeguards are required for certain research investigations. For example, more stringent requirements may be needed for research activities that involve more potent toxic substances as well as for substances for which there are recognized hazards of intermediate risk.

Stock quantities of compounds in this category should be stored in purpose-built cabinets according to safety and building codes. In the research laboratory, minimum quantities should be available as dictated by programs of study. The quantities in the laboratory should be limited to the lowest amount reasonable for the specified use.

The preparation of dilute solutions or the removal of small amounts of a toxic substance from stock quantities should be performed as much as possible within a laboratory fume hood or glove box. The work surfaces of the hood must be covered with stainless steel or plastic trays, dry absorbent plastic-backed paper, or other impervious material.

3. High Risk Situations

All laboratory procedures that involve the use of carcinogens, or very potent toxic substances, may require work practices and engineering controls in addition to those previously discussed. These may include: face-fitted respirators with filtering cartridges specific to the hazard, additional or more frequent changes of protective clothing, shower facility and change room, use of primary containment devices, work area access control, and monitoring for environmental contamination resulting from certain laboratory operations. Protective clothing such as disposable pants, shirts, jumpsuits, shoes and head covers, and plastic and latex gloves must be worn as appropriate. Showers are recommended after each exit from the work area.

These substances require special facilities for handling. The module must have a separate hood exhaust and glove box or other completely closed containment system. Work areas must be separated by a controlled access area from areas that are open to unrestricted traffic flow. This controlled access area may be an anteroom, a change room, and air lock, or any other door arrangement that separates the laboratory from areas of unrestricted traffic flow. Areas which meet these requirements are called Carcinogen Dilution Modules. Laboratories which do not have a Carcinogen Dilution Module must obtain permission from the Hazardous Chemical Safety Officer for the use of the existing facilities or must construct an equivalent facility of their own for laboratory operations that involve the storage or handling of these chemicals.

D. Facility Requirements (minimum)

A hand washing facility must be available within the work area. (This need not be a
facility used exclusively for hand washing.) The use of liquid soap is
recommended. In new facilities, foot or elbow operated faucets should be
provided.

- 2. An emergency drench shower shall be located in any area where toxic or corrosive chemicals are used. The shower facility must be clearly marked.
- 3. A secondary shower facility adjacent to the work area is recommended for total body cleansing in areas where acutely toxic substances are used.
- 4. A fire blanket should be maintained in a laboratory area where high voltage equipment or similar hazards would make the use of a safety shower dangerous. The location of the blanket must be clearly marked.
- 5. An emergency eye wash facility must be located in each laboratory. The eye wash facility must be clearly marked.
- 6. All emergency stand-alone eye wash stations must be tested on a weekly basis. All bottled eye wash stations must be within the noted expiration date.
- 7. A laboratory fume hood shall serve as the primary hazard control device while working with toxic or other hazardous materials/substances. Each laboratory in which volatile hazardous materials/substances are used shall have a functional fume hood with adequate face velocity and ventilation according to laboratory and building codes. In any case ventilation should be sufficient to remove all vapors to the exterior of the building and not endanger people outside the building.
- 8. Each laboratory shall have proper, purpose built storage facilities, depending on the chemicals used in the laboratory, e.g. flammables, corrosives, etc.
- 9. Each laboratory should have a spill kit suitable for the materials used in that laboratory. This should be kept by the entrance to the laboratory to ensure access to it.
- 10. Each laboratory shall have specific waste containers for broken glass and other sharp waste. Special containers are available from the Safety Office.
- 11. Each laboratory shall keep available sufficient eye protection for visitors.
- 12. The functioning of emergency showers, blankets, etc. should be checked monthly.
- 13. Any shower or eye wash that is not in good working order must be corrected by submitting a work order to Facilities Management.

E. Operational Practices

- Entrances to all work areas where hazardous substances are being used or stored
 must be posted with a sign stating that "This room contains Chemical and/or
 Electrical Hazards," the name of the P.I. or Instructional Supervisor, and other
 emergency contacts and phone numbers. A standard sign for this purpose is
 available from the Hazardous Chemical Safety Officer.
- Access doors to work areas where carcinogens or highly toxic substances are used or stored should be kept closed while experiments with such substances are in progress.
- 3. All work surfaces (bench tops, hood floors, etc.) on which toxic substances are used must be covered with stainless steel or plastic trays, dry absorbent plastic-backed paper, or other impervious material. The protective surfaces must be examined for possible contamination immediately after each procedure with a toxic substance has been completed. Contaminated surfaces must be decontaminated or disposed of according to prescribed procedures.

- 4. Procedures involving volatile toxic substances and those involving solid or liquid toxic substances that may result in the generation of aerosols must be conducted in a laboratory fume hood, a glove box, or other containment equipment. Examples of aerosol-producing procedures are the opening of closed vessels, transfer operators, weighting, preparation of feed mixtures, and the application, injection or incubation of a toxic substance into experimental animals. BioHazard or radiation hazards must be treated according to the appropriate manual.
- Toxic vapors or aerosols produced by analytical instruments must be captured through local exhaust ventilation or appropriate trap at the site of their production. The instruments may be placed entirely within a laboratory fume hood if this will not impair hood performance (i.e., toward the back and raised on legs to minimize turbulence of inflowing air). When a sample is removed from the analytical instrument, it must be placed in a tightly stoppered sample tube or otherwise safeguarded from contaminating the laboratory. In the event that the analytical equipment becomes contaminated, it must be labeled "CAUTION TOXIC SUBSTANCE" until it has been completely decontaminated. This operational practice applies to analytical equipment even when only infrequently used for toxic substance.
- 6. Stock quantities of toxic substances must be stored in a specific storage area that is secure at all times. The storage area must be posted with a sign bearing the legend: CAUTION Toxic Chemical Storage Area. Additional storage precautions may be required for compounds with properties such as flammability, radioactivity, etc.
- 7. Laboratory areas, including chemical storage areas shall be secured from access by unauthorized persons. Such security shall be maintained by:
 - Storing materials in lockable storage areas or laboratories.
 - Storing and using the materials in a laboratory or room that is locked when unattended.

Furthermore, access to the laboratory areas should be limited to persons with laboratory or maintenance related functions. Unfamiliar persons entering the laboratories should be asked for the purpose of their presence.

F. Personnel Practices

1. Precautionary

Know the safety rules and procedures that apply to the work you are doing; make note of the appropriate safety precautions and potential hazards via SDS and SOPs before beginning any operations.

Review the applicable emergency procedures; know where the emergency equipment is located in your area, how to use it, and how to obtain help in an emergency.

Assure the availability of the proper protective equipment and use the proper type for each operation.

Be alert to unsafe conditions and actions and have them promptly corrected. Someone else's accident can be as dangerous to you as any you might have.

Remain out of the area of a fire or personal injury unless it is your responsibility to help meet the emergency.

2. Protective Clothing

PPE is required to be used at all times while in the laboratory. A laboratory coat or other suitable clothing which covers the arms and legs completely (long sleeved shirt and long pants) shall be worn when working in the laboratory.

A fully fastened, laboratory coat and full length pants must be worn by employees in laboratory areas when using hazardous substances. Major purposes of the laboratory coat are to protect the individual and to reduce the probability of taking toxic contamination from the laboratory. The laboratory coat shall be removed when leaving the work area in order to minimize the potential for cross-contamination.

Clothing contaminated by toxic substances must be decontaminated or disposed of immediately after an obvious exposure. Contaminated clothing must not be sent to the laundry until decontaminated. In situations where decontamination is not feasible, clothing must be disposed of as hazardous waste, in a manner approved by the Safety Office. Gloves which are appropriate to the specific situation must be used when handling toxic substances. Disposable gloves may be used only once and then must be discarded into the proper container. Such gloves must be discarded immediately after known contact with a toxic substance.

In normal laboratory work, special shoes are not required. However, footwear must provide adequate traction, support, and resistance to chemical spills. Athletic-type shoes are allowable provided the upper is intact and does not allow a liquid to readily soak through. Socks should be worn. Sandals, open-toed shoes, and cloth shoes are not allowed.

3. Pipetting

Mechanical pipetting aids must be used for all pipetting procedures. Oral pipetting is prohibited!

4. Eye Protection

Safety glasses must be worn by all workers and visitors in all specified laboratory work areas. Contact lenses may not be worn in certain laboratory work areas. It is the responsibility of the laboratory supervisor or the Principal Investigator to determine what additional eye protection may be required for a particular operation.

5. Personal Conduct

- a. Personal hygiene must be maintained if toxic substances are used; fingernails must be short and clean; hands and arms must be washed thoroughly before handling any object that goes to the mouth, nose, or eyes, and before leaving the laboratory.
- b. Toxic materials may not be handled by personnel with an unprotected break in the skin; the break must be covered with adhesive tape and appropriate rubber or vinyl gloves must be worn.
- c. There must be no eating, drinking, chewing gum or tobacco, smoking, or applying cosmetics while working in areas where toxic substances are in use; refrigerators in such areas must not be used for storing food or beverages.
- d. Distracting or startling other workers must be avoided; practical jokes or horseplay cannot be tolerated at any time in the laboratory.

6. Housekeeping

- a. Laboratories where toxic materials are handled must be kept neat and clean; clean-up procedures are required upon completion of each operation at the end of each day.
- b. Work areas must be free of equipment and material not required for the immediate operation.
- c. All chemicals must be correctly and clearly labeled with standard, diamond-shaped NFPA labels and stored; warning signs are required when unusual hazards exist such as radiation, laser operations, flammables, biological hazards, or other special concerns.
- d. Applicable waste disposal procedures must be followed; chemical reactions may require traps or scrubbing devices to prevent the escape of toxic gases.
- e. Exposure to hazardous and toxic vapors, mists, gases, and dusts must be minimized by preventing the escape of such materials into the working atmosphere; adequate ventilation must be ensured by use of exhaust hoods and other local ventilation.

Equipment must be used only for its designed purpose.

Reaction apparatus must be carefully positioned and clamped to permit manipulation without the need to move the apparatus.

Reagents must be combined in appropriate order; avoid adding solids to hot liquids.

7. Personal Monitoring

a. Each person is responsible for ensuring that his/her person, clothing, shoes, laboratory equipment, and work area surfaces are kept free of contamination. Before leaving the laboratory for even short periods, contaminated clothing must be removed; showering may also be necessary before leaving the laboratory for lunch and at the end of the day when highly toxic materials are being used by anyone in the laboratory. (When in doubt concerning the degree of toxic substance hazards present, consult the Hazardous Chemical Safety Officer for advice and assistance.)

8. Working Alone

A written hazard assessment evaluating the work environment including any necessary laboratory tasks must be completed by the Principal Investigator or laboratory supervisor prior to anyone working alone in a laboratory. Consideration should be given to the hazards present and perhaps elevated by working alone. Working alone shall not be permitted if experiments involve known and significant hazards. If the hazard assessment indicates that working alone is acceptable, it is recommended that an arrangement be made with others to cross check periodically.

9. Leaving Employment at NDSU

a. All instructional, administrative, and research personnel are required to dispose of laboratory and chemical hazards for which they have been responsible. First, they must ascertain that the materials are unwanted, then they must dispose of the materials according to the guidelines in Section V - Chemical Waste Management. Personnel may only leave employment when the exit form has been properly executed according to this requirement.

G. Inspections

Laboratory safety inspections will be conducted annually for compliance with the Chemical Hygiene Plan. The inspections will be coordinated by the Hazardous Chemical Safety Officer. They may be conducted by the department Safety Representative, the Principal Investigator, or the Safety Officer at the direction of the Laboratory and Chemical Safety Committee. Noted deficiencies will be reported to the appropriate Chair, Head or Director of a Department, or the responsible trades area of Facilities Management with a time frame for corrective action of 30 days. For particularly hazardous situations, immediate response may be indicated. Expectation is that the noted items will either be corrected or a plan of corrective action will be prepared and submitted to the Safety Office within the 30 day period. Periodic follow up inspections will verify corrections have been implemented. If, upon re-inspection, the deficiency still remains and no corrective action plan has been implemented, an additional report will be submitted to the original recipient's supervisor. This escalation process will continue up through the Vice President level at which point any non-compliance reports will be submitted to the University Internal Auditor.

III. Working with Nanomaterials

A. Introduction

Nanotechnology is the manipulation of matter on a near-atomic size scale to produce new structures, materials, and devices. Materials exhibit unique properties at the nanoscale level, which affect their physical, chemical, and biological behavior. Nanomaterials are engineered materials having at least one dimension between 1 and 100 nanometers.

Nanomaterials are of considerable scientific interest because some material properties change at this scale. However, these changes also challenge researchers' and safety professionals' understanding of hazards, and their ability to anticipate, recognize, evaluate, and control potential health, safety, and environmental risks.

The following program does not include incidental, unintentionally produced, naturally occurring nanomaterials, nanosized particles, such as viruses, volcanic ash, and nanoparticle byproducts of human activity.

B. Purpose

The purpose of the Nanomaterials Safety Plan is to provide a structure for recognizing, evaluating, and controlling hazards associated with nanomaterials research.

Exposures to these materials during research and development may occur through inhalation, dermal contact, or ingestion. Nanomaterials present new challenges to understanding, predicting, and managing potential health risks. They may interact with the human body in different ways than conventional materials, due to their extremely small size. For example, studies have established that the comparatively large surface area of inhaled nanoparticles can increase their toxicity. Such small particles can penetrate deep into the lungs and may move to other parts of the body including the liver and the brain.

The nanoparticulate forms of some materials show unusually high reactivity especially for fire, explosion, and catalytic reactions. Depending on their composition and structure, some nanomaterials may initiate catalytic reactions that would not otherwise be anticipated from their chemical composition.

At the current time, there are no federal regulations that specifically address health and safety implications of nanotechnology. Through DOE Policy 456.1 Secretarial Policy Statement on Nanoscale Safety and other communications, the Department of Energy has made it clear that it expects those engaged in nanoscience in DOE facilities to evaluate and control associated environmental, health, and safety risks.

As with conventional chemicals, research with nanomaterials must be conducted in a manner that is safe and responsible. This Chemical Hygiene Plan provides guidance for

working with toxic materials having hazardous properties. Nanomaterials will be treated as though they are toxic and otherwise hazardous material unless and until evidence shows otherwise.

Nanomaterials whose hazards have been studied should be managed in a manner consistent with the disclosed risks.

C. Control Preferences

In order to provide a safe work environment for research personnel, students and visitors, controls must be maintained wherever nanomaterials are used or stored. These controls may include engineered controls, administrative controls, and use of personal protective equipment.

D. Engineering Controls

1. Ventilation

- Conduct any work that could generate dispersible nanoparticles in an
 enclosure that either operates at a negative pressure relative to the worker's
 breathing zone, or is sealed. Examples of such enclosures include laboratory
 bench-top or floor-mounted chemical hoods and glove boxes.
- If the process cannot be enclosed, then any location at which nanomaterial or a hazardous precursor can enter the atmosphere should be controlled using other appropriate engineering controls. Examples include: a local exhaust system (i.e..a snorkel hood) or dedicated low-flow enclosures.
- Prior to release filter or scrub effluent (air) that has been demonstrated or is strongly suspected to contain nanoparticles whose hazards are not well understood.
- HEPA filtration is recommended.
- If it is not practical to handle dispersible nano particles in a containment system such as glove box, glove bag, chemical fume hood, or other airborne containment control system, a hazard analysis including workplace monitoring shall be conducted in conjunction with the NDSU Safety Office and documented before implementing alternative hazard controls.
- Do not recirculate exhaust containing nanoparticulate materials within the laboratory.
- Filters, scrubbers or bubblers appropriately used to treat unreacted precursors and effluent may also be effective in reducing nanomaterial emissions. If using portable bench top HEPA filter units, exhaust them to the local exhaust system.
- Exhaust Type II biological safety cabinets, in which free nanomaterials are handled, directly to the lab ducting. Air from inside the cabinet, even if filtered, shall not be recirculated within the laboratory.

E. Administrative Controls

1. Housekeeping

- Practice good housekeeping in laboratories where nanomaterials are handled.
- Maintain working surfaces free of engineered nanoparticle contamination, insofar as practicable.

- Perform precautionary cleaning in areas where engineered nanoparticle might settle. For example, wipe horizontal surfaces with a moistened disposable wipe. This should be done no less frequently than at the end of each shift. Work Practices
- Transfer nanomaterial samples between workstations (such as exhaust hoods, glove boxes, furnaces) in closed, labeled containers, such as marked and sealed bottles or "Zip-Lock" bags.
- Take reasonable precautions to minimize the likelihood of skin contact with engineered nanoparticles or nanoparticle-containing materials likely to release nanoparticles (nanostructures).
- If engineered nanoparticle powders must be handled without the use of exhaust ventilation (i.e., laboratory exhaust hood, local exhaust) or enclosures (i.e. glove box), evaluate hazards and implement alternative work practice controls to minimize the likelihood of contamination and exposure hazards (vide infra).

2. Work Practices

- Transfer nanomaterial samples between workstations (such as exhaust hoods, glove boxes, furnaces) in closed, labeled containers, such as marked and sealed bottles or "Zip-Lock" bags.
- Take reasonable precautions to minimize the likelihood of skin contact with engineered nanoparticles or nanoparticle-containing materials likely to release nanoparticles (nanostructures).
- If engineered nanoparticle powders must be handled without the use of exhaust ventilation (i.e., laboratory exhaust hood, local exhaust) or enclosures (i.e. glove box), evaluate hazards and implement alternative work practice controls to minimize the likelihood of contamination and exposure hazards (vide infra).

3. Signage

- Post work areas with the ADesignated Nanoparticle Work Area@ sign where nanoparticles are handled. This could be either a work area within a lab, or the entire lab.
- If engineered nanoparticlulate powders must be handled without the use of exhaust ventilation, post the entire lab as ADesignated Nanoparticle Work Area and use appropriate personal protective equipment (vide infra).

4. Labeling

- Indicate on container labels that the contents are in nanoparticulate form, e.g., Ananoparticulate zinc oxide@ rather than simplyAzinc oxide.@
- If the morphology (shape) of the nanoparticles is known, this information should be included on the label as fibers may pose a greater hazard than spheres.

F. Personal Protective Equipment

1. General requirements

- Wear appropriate personal protective equipment on a precautionary basis whenever the failure of a single control, including an engineered control, could put researchers or support personnel at significant risk.
- The Principle Investigator, in conjunction with the NDSU Safety Office
 personnel will conduct a hazard evaluation to determine the selection and use
 of appropriate personal protective equipment.

2. Clothing

Wear clothing appropriate for a laboratory as per Section II.F.2. of this plan and including:

- Close-toed shoes made of a low permeability material. (Disposable over-the-shoe booties may be necessary to prevent tracking nanomaterials from the laboratory.)
- Safety glasses with side shields
- Disposable laboratory coats. These coats should be handled as hazardous waste.
- If non-disposable laboratory coats are preferred, they should remain in the laboratory area to prevent nanoparticles from being transported into the common areas. The coats should be placed in closed bags before being taken out of the laboratory for cleaning.

3. Gloves

- Choose and wear appropriate gloves after considering the resistance of the glove to the chemical attack by both the nanomaterial and, if suspended in liquids, the liquid.
- Exposure to nanomaterials is not known to have Agood warning properties@ so gloves should be changed frequently.
- The contaminated gloves should be kept in a closed container in the work area until disposal as hazardous waste.
- Outer gloves made of other material, such as cotton, may be used for protection when handling nanomaterials in bound form.
- Wash hands and forearms after wearing gloves.

4. Respiratory Protection

- The appropriate respirator and cartridge combination should be worn when deemed necessary by a safety assessment directed by the Principle Investigator in conjunction with NDSU Safety Office personnel.
- Personnel must complete the NDSU Respiratory Protection Program. If a respirator is indicated, it should be at a minimum half-mask, P-100 cartridge-type respirator that has been properly fitted to the worker.
- ADust masks@ shall not be worn in the place of a half mask respirator with a P-100 cartridge.
- Spent P-100 cartridges will be considered and handled as hazardous waste.

5. Exposure Assessments

- The Principal Investigator should consider Abaseline@ monitoring of nano activities by measuring conditions prior to start up. Measurements should be taken again at the conclusion of system commissioning and periodically thereafter.
- If nanoparticle exposure is suspected, contact the NDSU Safety Office to arrange an area survey.

G. Personnel Identification

Any staff member meeting one or more of the following criteria will be considered an Aengineered nanoparticle worker@:

- Handles engineered nanoscale particulates that have the potential to become dispersed in the air.
- Routinely works in an area in which engineered nanoparticles have the potential to become dispersed in the air.
- Works on equipment that is believed to be contaminated and could foreseeably release engineered nanoparticles during servicing or maintenance.
- Workers who satisfy the definition of an Aengineered nanoparticle worker@ shall be appropriately trained (vide infra).

H. Training

Workers must receive appropriate training prior to working with nanomaterials.
 This includes the reading of laboratory-specific nano SOPs and this section of

this Chemical Hygiene Plan. The inclusion of specific procedural requirements into the laboratory-specific nano SOPs will lead to better understanding and competence of the worker. Training should cover requirements and recommendations for:

- Engineered controls employed
- Use PPE
- Cleaning of potentially contaminated surfaces
- Steps to be taken in the event of an exposure incident or spill
- Specific nanomaterial-related health and safety risks
- Do not assume that staff members and visiting researchers are aware of the health and safety concerns posed by nanomaterials. Alert personnel in each group to potential hazards and to NDSU policies regarding nanomaterials.

I. Medical Surveillance

- Employees with jobs involving the potential for [or Areasonably anticipated@]
 respiratory or skin exposure to nanomaterials must have their name added to
 the list of NDSU nanomaterial workers. The list of employees shall be sent by
 the Principal Investigator to the Safety Office.
- The list of nanomaterial workers will be maintained by the NDSU Safety Office.
- Any employees involved in any incident that results in an unexpected and/or unusually high exposure to nanomaterials, through any route of entry, should be examined by the designated medical provider.

J. Waste

- Do not dispose of nanomaterial-bearing waste streams directly into the sanitary sewer system (i.e. down a sink drain).
- Evaluate surface contamination or decontaminate equipment used to manufacture, handle, or capture nanoparticles before disposing or reusing it.
- Label Hazardous Waste Log sheet and label container as to waste containing nanomaterials.
- Package nanomaterial-bearing waste in containers that are compatible with the contents, in good condition, and that afford adequate containment to prevent the escape of the nanomaterials.
- Do not place nanomaterials in the regular trash.
- Used HEPA filters must be labeled as being contaminated with nanoparticles, collected, and disposed of as hazardous or potentially hazardous waste.

K. Nanomaterial Spills

- Determine the extent of the area reasonably expected to have been affected, and demarcate it with barricade tape or use another reliable means to restrict entry into the area.
- For clean-up of significant spills, call 1-7759 for assistance. Indicate that the spill involves nanomaterials.
- For smaller spills, trained nano workers can clean up the spill following their laboratory's specific spill plan.
- Any worker exposed to nanomaterials as the result of a spill or in the course of a spill clean-up must file an NDSU Incident Report.
- At a minimum, the following procedures must be followed when managing an accidental spill of nanomaterials.

Dry Material Spills

- Position a walk-off mat (e.g., Tacki-Mat) where clean-up personnel will exit the access-controlled area to reduce the likelihood of spreading nanoparticles.
- Clean using wet wiping methods. Manage, collect, and dispose of spill clean-up materials as nanomaterial-bearing waste.
- Do not dry sweep spilled accumulations of dry nanomaterials. Use only HEPA-filtered vacuum cleaners to clean up nanoparticles.

- If vacuum cleaning is employed, care should be taken that HEPA filters are installed properly, and bags and filters changed according to manufacturer's recommendations.
- Consider the possible air reactivity of nanoparticles prior to using a vacuum cleaner. Some normally stable powders may become pyrophoric if deposited on a filter and subject to high airflow.

Liquid Spills

- Employ normal HazMat response based on the spilled material's known hazards. The following are additional considerations to mitigate nanomaterials left behind once the liquids have been removed.
- Position an absorbent walk-off mat where the clean-up personnel will exit the access controlled area.
- Place barriers (e.g. plastic sheeting) to minimize air currents across the surface affected by the spill.
- Use a wet-wiping method to clean the spill. A HEPA-filtered vacuum may also be used to clean up residual nanomaterials left behind after the spill area has dried.
- Manage materials used to clean up the spill (absorbent mats, absorbent material, wipes, etc.) as hazardous or potentially hazardous waste based on the material involved.

IV. Emergency Procedures

Emergencies will generally be in the nature of personal injuries, spills, fires, or explosions, which may result in the spread of hazardous material.

The primary consideration is to deal with the emergency. Alert a responsible person; the appropriate emergency services should be called directly, if necessary. The Safety Office should then be notified. Since it is not possible to devise a set of rules or procedures to govern all possible emergencies, the considerations in Appendix 1, Section IV are presented only as a guide to aid the user in establishing more specific emergency procedures applicable to his or her working conditions.

All employees are responsible for reporting any accidental spill of a toxic substance and accidents involving potential exposure (inoculation, ingestion, dermal contact, and inhalation) to the Hazardous Chemical Safety Officer and the Principal Investigator. The Hazardous Chemical Safety Officer will coordinate the accident-reporting requirements and the clean-up procedures.

A. Near Miss or Hazardous Situation

- 1. An Incident/Near Miss Report shall be filed when an employee is involved in or witnesses an incident that did not result in personal injury or property damage, but had the potential to do so and could happen under the existing conditions.
- 2. An Incident/Near Miss Report shall be filed when circumstances arise that constitute a hazardous situation. This is the mechanism whereby corrections can be made prior to an accident, spill, etc.

V. Chemical Waste Management

These guidelines are intended to provide safe, practical methods for the management of hazardous chemical waste at North Dakota State University.

For materials that require removal and disposal, a pickup service is provided by the Hazardous Chemical Safety Office at 1-7759.

A. General Policies

- 1. Contact the University Police & Safety Office Safety Office, at 1-7759 for any questions regarding the proper handling/disposal method of a particular material.
- The Principal Investigator or Instructional Supervisor has the responsibility for identifying and labeling chemical waste generated. Guidance to the definition of hazardous waste is contained in Appendix 3. He/she must follow all procedures in these guidelines and shall provide proper instruction to personnel under his/her jurisdiction.
- 3. Do not dispose of chemicals unnecessarily. If you have no further need of a reagent, determine whether or not colleagues at your site can use it. Use and redistribute materials according to their intended purpose, if possible, to alleviate disposal problems.

NOTE: Hazardous Materials shall not be offered for transport thru shipping channels without the shipper of said material having completed a Hazardous Material Shipping Training and receiving a certificate of completion. Please reference the NDSU Hazardous Material Shipping Procedures available through the University Police & Safety Office - Safety Office, 1-7759.

- 4. Waste or outdated chemicals should not be allowed to accumulate in any location to a point that would create an unsafe working environment for laboratory personnel, students, or other workers.
- 5. Waste chemicals should always be segregated and labeled according to compatibility while being stored prior to being removed by the Hazardous Chemical Officer. The segregation of chemicals assures the safety of the chemical user and Hazardous Chemical Safety personnel and regulatory compliance for the University.
- 6. Do not mix (e.g. halogenated solvents with non-halogenated solvents) waste chemicals. Collect the material in separate waste containers if at all possible. Mixing of waste increases disposal costs.
- 7. When a waste container is used for compatible chemicals, each chemical must be identified, and its percentage of the final mixture must be indicated.
- 8. Empty containers should be triple-rinsed, using either water or a solvent capable of removing the original material, and reused whenever possible. If the container is reused, ensure the compatibility of the waste with the container. Containers which previously held liquids should be used to dispose of liquid (previous solid containers for solid disposal). Clearly re-label the container with a description of the present contents and remove or obliterate the previous label. All empty, rinsed chemical containers should be recycled through the Safety Office.
- 9. Unknown material cannot be disposed of (under State and Federal law) until the unknown has been properly identified. Charges for analytical services are expensive and it is to your advantage to properly label and identify all material in your work area. The chemical user/department will be charged for any analytical work necessary to identify unknowns.
- 10. Chemical waste disposal is expensive; therefore, every effort must be made to keep the quantities of hazardous chemicals to a minimum. When planning research and ordering materials, this should be taken into consideration (i.e. don't

University Police & Safety Office

- order 5 gallons if only one gallon is needed, even if the 5 gallon quantities have a lower unit cost).
- 11. Chemical waste generated at the University can be either non-hazardous solid waste or hazardous chemical waste. The term Awaste disposal@ refers to the process operated by the Hazardous Chemical Safety Officer which provides technical assistance in handling and preparation for disposal of hazardous chemical waste by contract disposal firms (see Appendix 2).
- 12. Call the Safety Office to dispose of all chemicals. Do not sewer chemicals or put materials in normal laboratory waste streams unless completely confident that they will do no harm to the janitorial staff, other service personnel, or the environment (this includes tissues, etc. or other materials used to clean up spilled chemicals).

Appendix 1-Guidance on Spills and Other Accidents

I. Minor Spills Involving Minimal Toxic Hazards to Personnel

- A. Notify all other persons in the room at once and, before proceeding with the cleanup notify the Hazardous Chemical Safety Officer.
- B. Confine the spill immediately.
- C. Permit into the area only the minimum number of persons required to deal with the spill.

1. Liquid spills:

- a. Wear protective gloves,
- b. Place Labsorb neutralizer, or absorbent paper, on the spill.

2. Dry spills:

- a. Wear protective gloves.
- b. Dampen spilled materials thoroughly taking care not to spread the contamination; use caution in dampening fine, dry particulate material so as not to create an aerosol; where chemical reactions with water are possible, use oil as an agent.
- c. Use swipe tests or fluorescence tests to assure adequate cleanup.
- d. Establish a plan and begin decontamination.
- e. Monitor all persons involved in the spill and cleanup operations.
- f. Prepare and submit to the Hazardous Chemical Safety Officer a complete description of any accident or spill involving a toxic substance and subsequent remedial and protective actions taken. This should be done on the NDSU Incident/Near Miss Report Form.

II. Major Spills Involving Toxic Hazards to Personnel

- A. Anyone involved in a spill must notify all persons not involved in the spill to vacate the area at once and limit the movement of displaced persons to confine the spread of contamination.
- B. If the spill is liquid, use a stick, tongs, or lever to place the spill container upright; the hands may be used only if protected or gloved appropriately. Spill kits are available and are required for limited access areas and laboratory rooms.
- C. If the spill is on the skin, wash the affected parts thoroughly with water or appropriate solution.
- D. If the spill is on clothing, remove and discard the contaminated clothing immediately.
- E. Shut off the power to all fans and air circulators.
- F. Vacate the room
- G. Notify the Hazardous Chemical Safety Officer as soon as possible and include identification of material involved.
- H. Decontaminate personnel involved; obtain medical aid, if necessary.
- I. Decontaminate the area; personnel involved in decontamination must be adequately qualified and protected.
- J. Spills should be inactivated in situ or be absorbed by any appropriate method; check up with swipe tests or fluorescence tests.
- K. Monitor all persons involved in the spill and clean-up.
- L. Permit no one to resume work in the area without the approval of the Hazardous Chemical Safety Officer.
- M. Prepare and submit to the Hazardous Chemical Safety Officer a complete history of the accident and subsequent remedial actions on an Incident/Near Miss Report.

III. Accidents Involving Toxic Dusts, Mist, Fumes, Organic Vapors and Gases.

- A. Anyone involved in an accident must notify all other persons to vacate the area immediately.
- B. Refrain from breathing as much as possible; close the escape valves on the container leaking the contaminant. Use a respirator if necessary.
- C. Vacate the room and, if necessary, activate the fire alarm to vacate the building.
- D. Notify the Hazardous Chemical Safety Officer.
- E. Ascertain that all doors to the room are closed; post conspicuous warnings or guards to prevent accidental opening of the doors or entry.
- F. Monitor all persons suspected of contamination.
- G. Proceed with decontamination of personnel.
- H. Report at once all known or suspected inhalations of toxic materials.
- I. Evaluate the hazard and the necessary safety devices for safe re-entry.
- J. Determine the cause of contamination and rectify the condition prior to the start of any area decontamination operations.
- K. Establish a plan of operation and begin decontamination of the area. Check adequacy of clean-up with swipe tests or fluorescence tests.
- L. Perform an air survey of the area before permitting normal work to be resumed.
- M. Prepare and submit to the Hazardous Chemical Safety Officer a complete history of the accident and subsequent remedial actions on an Incident/Near Miss Report.

IV. Fires or Other Major Emergencies

- A. Anyone involved in a fire or other emergency must notify all other persons in the room and building at once.
- B. Contact the Fire Department and Safety personnel including the Hazardous Chemical Safety Officer.
- C. Extinguishing the fire may be attempted if a toxic hazard is imminent, or if the fire is small in size.
- D. Restrict fire fighting and other emergency activities to the guidelines and rules prescribed by the Hazardous Chemical Safety Officer.
- E. Monitor all persons involved in combating the emergency.
- F. Following the emergency, monitor the area and determine the protective devices required for safe decontamination.
- G. Establish a plan of operation and begin decontamination in the area.
- H. Permit no one to return to work without the approval of the Hazardous Chemical Safety Officer.
- Prepare and submit to the Hazardous Chemical Safety Officer a complete history of the emergency and subsequent remedial or protective actions on an Incident/Near Miss Report.

V. First Aid

Report all hazardous material accidents with possible health effects, wounds, ingestion, inhalation, etc., to a physician or other professional medical person immediately; use extreme care in providing emergency comfort or first aid treatment, so as to avoid aggravating the injury. (Washing under running water may be attempted.)

A. For wounds:

- 1. Wash wound or affected area immediately under running water, spreading the wound sufficiently to allow good rinsing.
- 2. Call or take the injured person to a physician or other person qualified to treat toxic injuries.
- 3. Retrieve the Material Safety Data Sheets for chemicals involved and bring with patient to the Medical Provider.
- 4. Employ appropriate measures to prohibit the spread of toxic material by the injured.

- 5. Permit no person injured by toxic substances to return to work without the approval of the physician and the Hazardous Chemical Safety Officer.
- 6. Prepare accident and injury reports as required for the Hazardous Chemical Safety Officer and the Personnel Office.
- 7. Prepare and submit to the Hazardous Chemical Safety Officer a complete history of the accident and subsequent actions on an Incident/Near Miss Report.

Appendix 2-Chemical Waste Removal

I. Requesting Chemical Waste Removal

To request the pickup of hazardous chemical waste, the Principal Investigator or other individual designated by the Principal Investigator shall call the Hazardous Chemical Safety Office (1-7759).

The following procedures must be completed before a chemical waste pickup will be made:

- A. All waste containers must be tightly capped. Screw-type closures (caps or lids) are required on all containers. Corks, cotton plugs, plastic sheeting, etc., are not acceptable for bottles which contain liquids. Flasks and beakers are not acceptable containers for liquid or solid waste. Place liquid and solid wastes into 2 2 gallon plastic jugs supplied by the Safety Office. Make sure chemicals are compatible before mixing. Waste containers must be labeled with contents, even during use.
- B. Chemicals that are in their original containers and separated into the following categories: (PL) Poisonous Liquid, (PS) Poisonous Solid, (FL) Flammable Liquid, or (FS) Flammable Solid should be placed in boxes so that they can be easily carried by hand. Chemicals which have the potential to react with each other should not be packed in the same box (e.g., chlorates with ammonium salts, acids with bases, cyanides with acids, etc.).
- C. An NDSU Hazardous Waste Form must be completed for each container of waste. The form (see Appendix 4) requires entries for the Principal Investigator, building, department, room number, telephone number, date, classification of waste, specific contents and amount and signature.

Appendix 3-Definitions

I. Definition of AHazardous Waste@

A. Characteristics of Hazardous Waste (40 CFR, Part 261, Subpart C)

Using the Environmental Protection Agency criteria, a solid waste (including solid, liquid, semisolid, or contained gaseous materials) is considered a hazardous waste if it is listed by EPA in 40 CFR Part 261, Subpart D, or exhibits any of the following four characteristics.

1. Ignitability/Flammability (Environmental Protection Agency Identification No.-D001).

- A. It is a liquid and has a flash point less than 60o C (140o F) as determined by a Pensky-Martens Closed Cup Tester, using the test method specified in ASTM Standard D-93-79 or D-93-80.
- B. It is not a liquid and is capable, under standard temperature and pressure, of causing a fire through friction, absorption of moisture or spontaneous chemical changes, and when ignited, burns so vigorously and persistently that it creates a hazard.
- C. It is an ignitable compressed gas or an oxidizer as defined in the Code of Federal Regulations.

2. Corrosivity (Environmental Protection Agency Identification No.-D002).

- A. It is aqueous and has a pH less than or equal to 2 or greater than or equal to 12.5 or corrodes steel at a rate of 6.35 millimeters per year at a test temperature of 550 C.
- B. A solid waste that exhibits the characteristics of corrosivity has the EPA Hazardous Waste Number of D002.

3. Reactivity (Environmental Protection Agency Identification No.-D003).

- A. It is normally unstable and readily undergoes violent change without detonating.
- B. It reacts violently with water.
- C. It forms potentially explosive mixtures with water.
- D. When mixed with water, it generates toxic fumes, gases, or vapors in a quantity sufficient to present a danger to human health or environment.
- E. It is a cyanide or sulfide bearing waste which, when exposed to pH conditions between 2 and 12.5, can generate toxic gases, vapors, or fumes in a quantity sufficient to present a danger to human health or the environment.

4. Carcinogenic Chemicals

Lists are available from the International Agency for Research on Cancer and/or in the U.S. Department of Health and Human Services. MSDS's are required to contain notification if a chemical is a carcinogen or suspected carcinogen.

The following list was compiled from chemicals identified by the International Agency for Research on Cancer and/or in the U.S. Department of Health and Human Services Third Annual Report on Carcinogens as showing sufficient evidence from epidemiological studies to support a casual association between exposure and cancer. This is a list of known carcinogens, as opposed to suspected carcinogens.

- . 2-Acetylaminofluorene
- . 4-Aminobiphenyl
- . o-Anisidine
- . Asbestos
- . Azathioprine
- . 4-Butanediol Dimethonesulfonate (Myleran)
- . Benzene
- . Benz(a)anthracene
- . Benzidine
- . Benzo(a)pyrene
- . N,N-bis(2-chloroethyl)
- -2-naphthylamine (chlornaphazine)
- Bis(chloromethyl)ether (BCME) and technical grade chloromethyl methyl ether (CMME)
- . 1,3-Butadiene
- . Chlorambucil
- . Chromium and certain chromium compounds

- . Coke oven emissions
- . Cyclophosphamide
- . Di(2,3-epoxypropyl) Ether (DGE)
- . Diethylstilbestrol (DES)
- . Hvdrazine
- . Melphalan
- . Methoxsalen with Ultra-Violet A Therapy (PUVA)
- . Mustard gas
- . 2-Naphthylamine
- . 5-Nitro-o-anisidine
- . Nitroso-organic compounds
- . Polychlorinated Biphenyls (PCBs)
- . Tetrachlorodibenzo-p-dioxin (TCDD)
- . Thorium dioxide
- . Treosulphan
- . Vinyl chloride and/or vinyl bromide

B. Special Materials

There are specific types of waste that require special handling procedures due to restrictive packaging and disposal regulations. The following types of material must be handled by the Hazardous Chemical Safety Office.

1. Pesticides

Pesticides are controlled by the Environmental Protection Agency (and other agencies), therefore, organic and inorganic types should be handled by the Hazardous Chemical Safety Officer. All containers must be labeled indicating both the trade name and the chemical name of the active ingredient. Examples include insecticides, herbicides, fungicides, etc.

2. Carcinogens

 All carcinogens above must be handled by the Hazardous Chemical Safety Office. Containers should be placed in plastic bags and labeled carcinogenic prior to pickup.

3. Toxic

- a. Toxic is defined by OSHA 29 CFR 1910.1200 App A as a chemical which falls in any of these three categories:
- A chemical that has a median lethal dose (LD50) of more than 50 milligrams per kilogram but not more than 500 milligrams per kilogram of body weight when administered orally to albino rats weighing between 200 and 300 grams each.
- A chemical that has a median lethal dose (LD50) of more than 200 milligrams per kilogram but not more than 1,000 milligrams per kilogram of body weight when administered by continuous contact for 24 hours (or less if death occurs within 24 hours) with the bare skin of albino rabbits weighing between two and three kilograms each.
- A chemical that has a median lethal concentration (LC50) in air of more than 200 parts per million but not more than 2,000 parts per million by volume of gas or vapor, or more than two milligrams per liter but not more than 20 milligrams per liter of mist, fume, or dust, when administered by continuous inhalation for one hour (or less if death occurs within one hour) to albino rats weighing between 200 and 300 grams each.

4. Highly toxic

- a. Highly toxic is defined by OSHA as:
 - (1) A chemical that has a median lethal dose (LD50) of 50 milligrams or less per kilogram of body weight when administered orally to albino rats weighing between 200 and 300 grams each.
 - (2) A chemical that has a median lethal dose (LD50) of 200 milligrams or less per kilogram of body weight when administered by continuous contact for 24 hours (or less if death occurs within 24 hours) with the bare skin of albino rabbits weighing between two and three kilograms each.
 - (3) A chemical that has a median lethal concentration (LC50) in air of 200 parts per million by volume or less of gas or vapor, or 2 milligrams per liter or less of mist, fume, or dust, when administered by continuous inhalation for one hour (or less if death occurs within one hour) to albino rats weighing between 200 and 300 grams each.

5. Peroxidizable Chemicals

a. Peroxidizable chemicals such as those listed below should be dated upon receipt. Storage and use should be limited to the time indicated for each class or list. Containers which show signs of iron oxide or copper oxide should be handled with extra precaution since many metal oxides promote peroxide formation.

The most hazardous compounds - those that form peroxides without being concentrated, which can accumulate a hazardous level of peroxides simply on storage after exposure to air - are in List I. Compounds forming peroxide that is hazardous only when concentrated are in List II. List III consists of vinyl monomers that may form peroxides which can initiate explosives polymerization of the monomers. These lists are not exhaustive.

List I	List II	List III
12 Months	18 Months	18 Months
Peroxide Hazard on Storage	Peroxide Hazard on Concentration	Hazard Due to Peroxide Initiation of Polymerization*
Diethyl ether Isopropyl ether Divinyl acetylene Vinylidene chloride Ethylene glycol Di - Methyl ether (Glyme) Dicyclopentadiene Diacetylene Methyl acetylene Cumene Tetrahydronaphthalene Cyclohexene	Acetal Dioxane Tetrahydrofuran Vinyl ethers Vinyl acetylene Vinyl acetate Vinyl chloride Vinyl pyridine Chlorobutadiene (Chloroprene) Methylcyclopentane	Syrene Butadiene Tetrafluoroethylene Chlorotrifluoroethylene

^{*}When stored as a liquid, the peroxide-forming potential increases and certain of these monomers (especially butadiene, chloroprene, and tetrafluoroethylene) should be considered as List I compounds.

6. Polyhalogenated Biphenyls

a. PCB (Polychlorinated biphenyl), PBB (Polybrominated biphenyl), and chemically similar compounds.

7. Asbestos

a. It should be well sealed in the container, which should in turn be placed in a plastic bag and sealed.

8. Miscellaneous material

- a. The following materials require special handling procedures in order to comply with Department of Transportation and Environmental Protection Agency packaging and disposal regulations.
 - (1) Explosives (as defined by the Bureau of Alcohol, Tobacco, and Firearms).
 - (2) Shock sensitive material
 - (3) Cylinders (gas or liquid)

Appendix 4-Hazardous Waste Form

HAZARDOUS

NORTH DAKOTA STATE UNIVERSITY HAZARDOUS WASTE PROGRAM

(Packing Instructions on Reverse Side)

06782

V second					
Principal Investigator	Building _	Building			
Department		Room No	Room No		
Telephone Number		Date			
CLASSIFICATION	SPECIFIC (CONTENTS	AMOUNT		
			,		
*Toxicity or Hazard W	larnings on any of abo	ve articles:			
*Circle if recyclable.	RE	CYCLABLE			
	the above named artic and in proper condition				
SIGNATURE	DA	TE			
	SAFETY OFFICE	LISE ONLY			
Dialous Data	Initials				
Disposal Date Disposal Method					

Appendix 5-Toxins, Select Agents and Export Items

The following categories of toxins, select agents and export items require additional procedures and government enforcement to ensure faculty, staff and students are prevented from exposure and antagonists of the United States of America do not have access to these toxins, select agents and export items.

If planning on using any materials with the following characteristics contact the Safety Office for additional guidance and requirements:

I. Highly toxic substances

- a. A Gas with a LC50 <= 200 mL/m3 Inhalation*
- b. A Liquid or Solid with a LD50 <= 5 mg/kg Oral**
- c. A Material with a LD50 <= 40 mg/kg in Dermal Contact**
- d. A Dust or Mist with a LD50 <= 0.5 mg/L**

II. Select agents and toxins

- a. Listed on either the CDC HHS or USDA Select Agents & Toxins List.***
- b. Refer to web link below for complete list.

III. Export controlled items

- a. US Department of Commerce: EAR****
- b. US Department of State: ITAR*****
- c. Refer to web links below for complete listing.

IV. References:

*Department of Transportation (DOT) 49 CFR 173.116(a) and DOT 49 CFR 173.115(c)(2) Website links:

http://edocket.access.gpo.gov/cfr_2003/octqtr/pdf/49cfr173.115.pdf http://edocket.access.gpo.gov/cfr_2003/octqtr/pdf/49cfr173.116.pdf

**Department of Transportation (DOT) 49 CFR 173.133(a)(1)

Website link: http://edocket.access.gpo.gov/cfr 2003/octgtr/pdf/49cfr173.133.pdf

***Centers for Disease Control and Prevention (CDC) 42 CFR part 73.3 and US Department of Agriculture (USDA) 9 CFR part 121.

Website links: http://www.selectagents.gov/Select%20Agents%20and%20Toxins%20List.html

****Export Administration Regulations (EAR)

Website link: http://www.access.gpo.gov/bis/ear/ear data.html

***** International Traffic in Arms Regulations (ITAR)

Website link: http://www.pmddtc.state.gov/